



# Service bulletin

0203

THE BRITISH MOTOR CORPORATION (AUSTRALIA) PTY. LIMITED

FOR THE ATTENTION OF SERVICE AND PARTS MANAGERS.

CARS

## RADIATOR SIDE EXTENSION REINFORCEMENT

To prevent the possibility of cracking of the Radiator Side Extension Supports under severe operating conditions, a running change incorporating reinforcement to the Radiator Side Extensions was introduced at the following approximate Chassis Numbers:

Wolseley 24/80	-	921
Austin Freeway Sedan	-	1268
Austin Freeway Station Wagon	-	794

The details overleaf outline the method of reinforcing existing vehicles if a failure has occurred, or, where it is known a vehicle is going to be used under severe conditions.

WOLSELEY  
24/80  
AUSTIN  
FREEWAY  
SEDAN  
AUSTIN  
FREEWAY  
STATION  
WAGON.

N. Prescott  
Service Manager.

S.


Page 1 of 1

19/ 8/62

From TP 1001

C203

LOCATE REINFORCEMENT TO  
DIMENSION SHOWN AND DRILL  
2 HOLES 9/32" DIA.

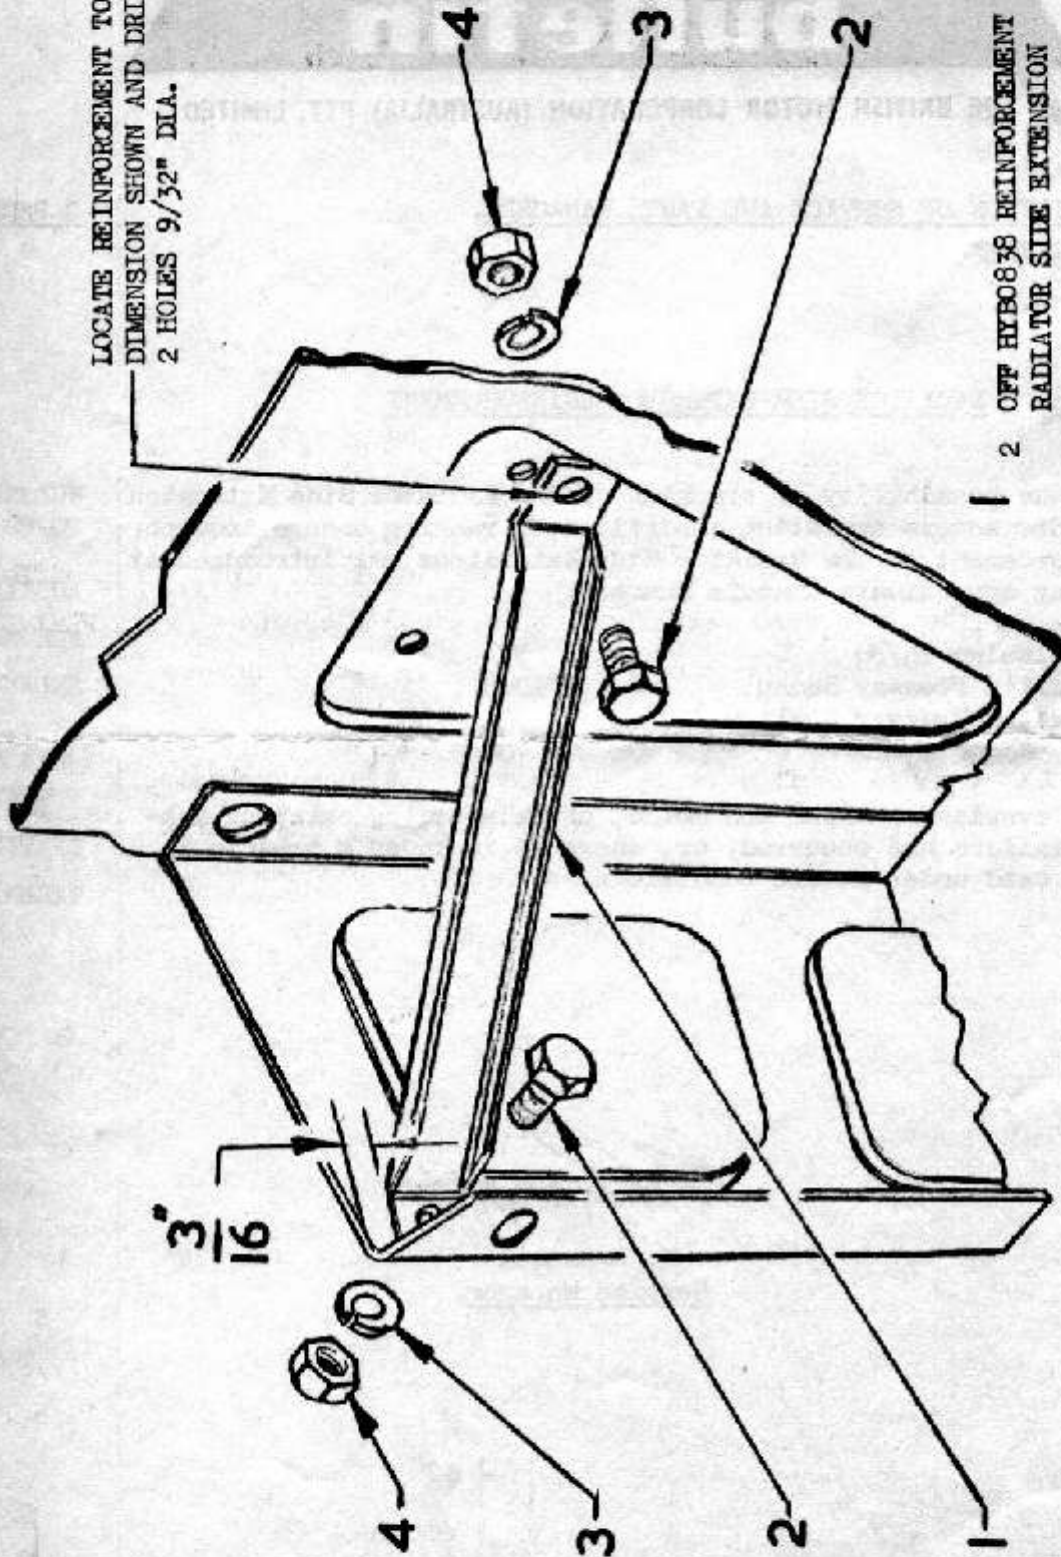

- 1 2 OFF HYB0838 REINFORCEMENT  
RADIATOR SIDE EXTENSION
- 2 4 OFF HZS 0404 1/4" x 1/2" HEL.  
HD. SCREW.
- 3 4 OFF LWF 0204 SPRING WASHER
- 4 4 OFF FNZ 0504 1/4" HEL. NUT.