



Service bulletin

C. 207

THE BRITISH MOTOR CORPORATION (AUSTRALIA) PTY. LIMITED

FOR THE ATTENTION OF SERVICE AND PARTS MANAGERS.

CARS

ACCELERATOR PEDAL BENDING.


To prevent the Pedal from bending at hinge joint and also from bowing through the length when fully depressed - due to a hard corner of rubber under pivot point - a service modification is to grind away the hard corner and if sheet metal holding screw cannot be kept in position they should be replaced with machine screws, nuts and washers.

MORRIS
ELITE

AUSTIN
FREEWAY

WOLSELEY
24/80

This modification has now been carried out in Production.

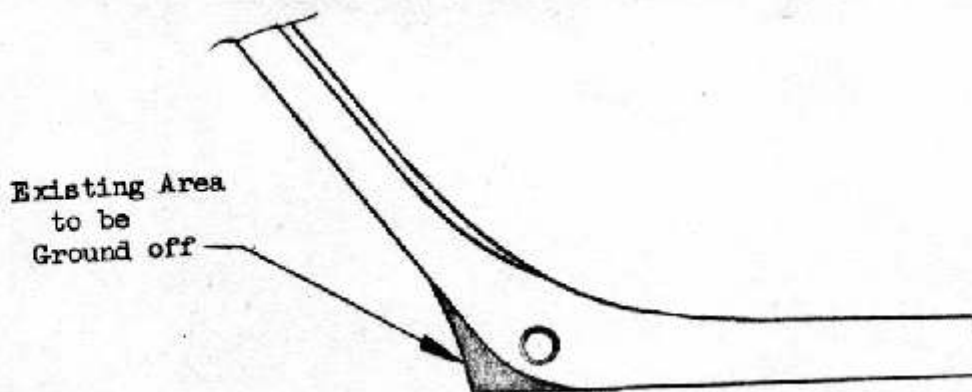

Hinge Joint of Pedal
showing hard corner

N. Prescott
N. Prescott
Service Manager.