



Service bulletin


THE BRITISH MOTOR CORPORATION (AUSTRALIA) PTY. LIMITED

C. 16/65
F. O. -
Exp. -
30. 7. 65
Sighted by:

FOR THE ATTENTION OF SERVICE AND PARTS MANAGERS

SCREWS FOR CENTRE SUPPORT AND PLUG ASSEMBLY

A number of vehicles have transmissions with one of the holes 'X' in the centre support machined $3/32$ " shallow. This has necessitated the shortening of the corresponding screw by approximately the same amount. With some units both screws have been shortened.

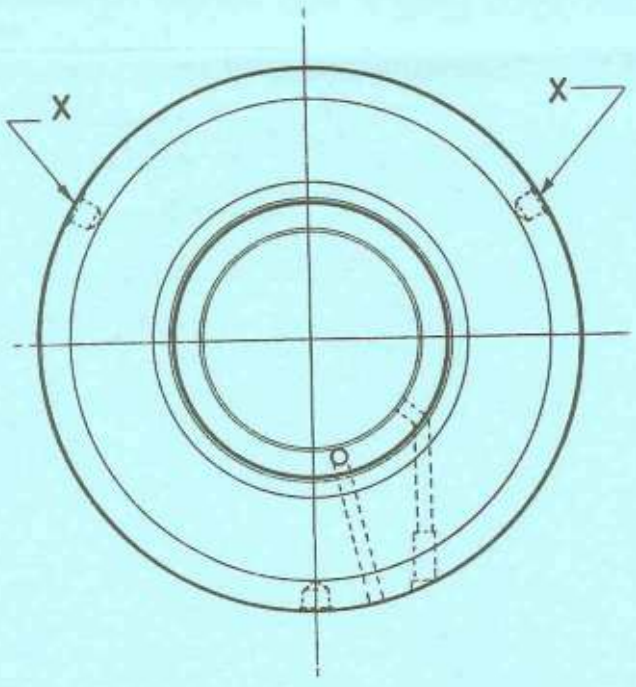


BORG-WARNER
AUTOMATIC
TRANSMISSION
MODEL 35

In cases of repair to these transmissions, mark the screws and bosses to ensure correct reassembly of the screws. If this is not done, bottoming and damage to the screw boss may occur.

Where both holes are at the standard reamed depth of 15/64" the foregoing obviously does not apply.

NOTE: Only standard length centre support screws 7H 6855 as illustrated below are available. Where a new short screw is required this will entail shortening of the standard item.

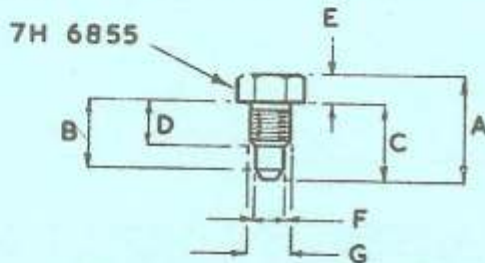

A	$1\frac{1}{16}''$	E	$\frac{9}{32}''$
B	$\frac{11}{16}''$	F	$\frac{245}{1000}''$
C	$\frac{25}{32}''$	G	$\frac{3}{8}''$
D	$\frac{1}{2}''$		

N. Prescott

N. Prescott
Service Manager

1D 26