



Service bulletin

THE BRITISH MOTOR CORPORATION (AUSTRALIA) PTY. LIMITED

C. 17/65

F. O. -

Exp. -

30. 7. 65


Sighted by:

FOR THE ATTENTION OF SERVICE AND PARTS MANAGERS

INHIBITOR SWITCH BOSS ON TRANSMISSION CASE

A few transmissions were produced recently with .030" excess material on switch boss 'A' of the transmission case.

Should difficulty be experienced in obtaining adjustment of the inhibitor switch, reduce the thickness of the switch locknut 'B' by .030".

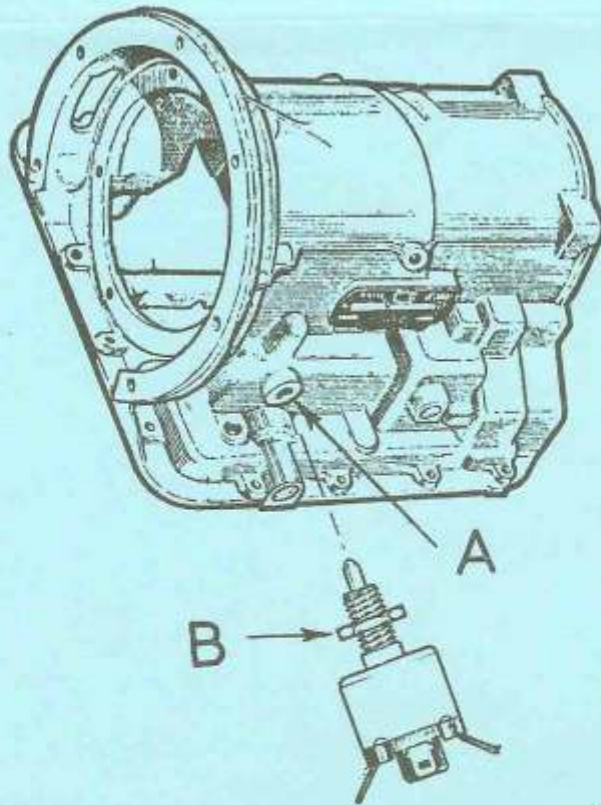

BORG-WARNER
AUTOMATIC
TRANSMISSION
MODEL 35

Prescott
N. Prescott
Service Manager

1D 23