

*M. K. Fleming*



# Service bulletin

C. 242  
EXP. 10

THE BRITISH MOTOR CORPORATION (AUSTRALIA) PTY. LIMITED

FOR THE ATTENTION OF SERVICE & PARTS MANAGERS.

MUD PENETRATION - CONVERTER HOUSING

Where vehicles are operating in very slushy conditions, the penetration of slush into the converter housing can cause seizure of the starter motor pinion. This can be eliminated by fabricating mud excluders by referring to diagrams over leaf.

Fit the mud excluders over the right and left hand wire mesh screen at the bottom of the converter by the existing bolts on the engine rear back plate, noting that the right hand excluder has an extended bracket which fits under the bottom set screw of the starter motor.

It is also necessary to cover the hole in the front of the rear engine backing plate which gives access to the converter set screws.

Wolseley  
24/80  
Automatic


Austin  
Freeway  
Automatic

S

Page 1  
of 3

30.7.63.

N. Prescott,  
Service Manager.

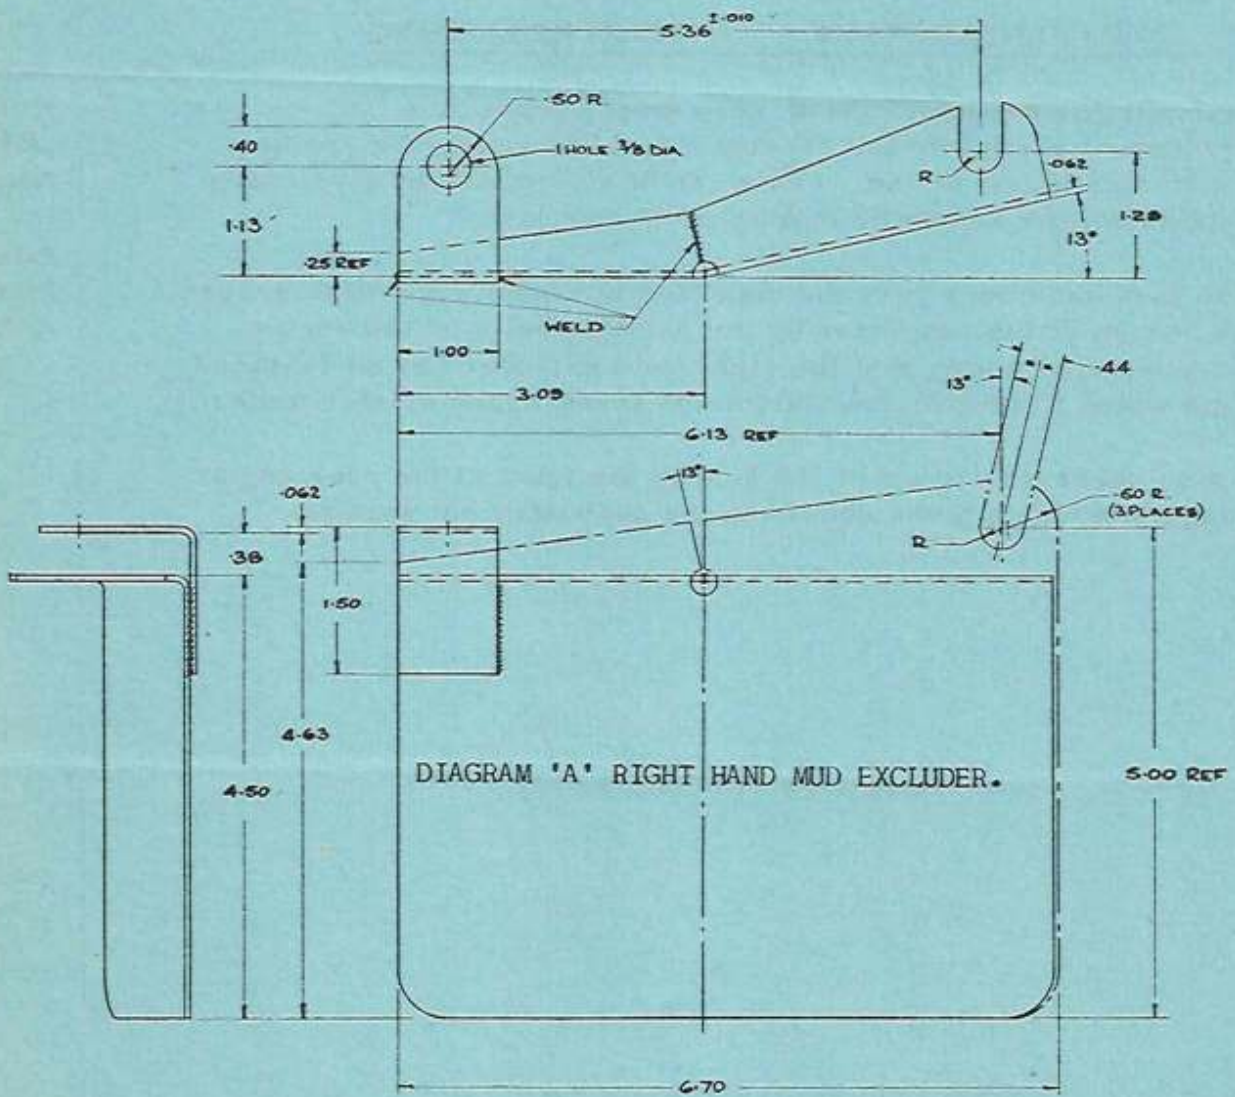

INSIDE BEND RAD. .09

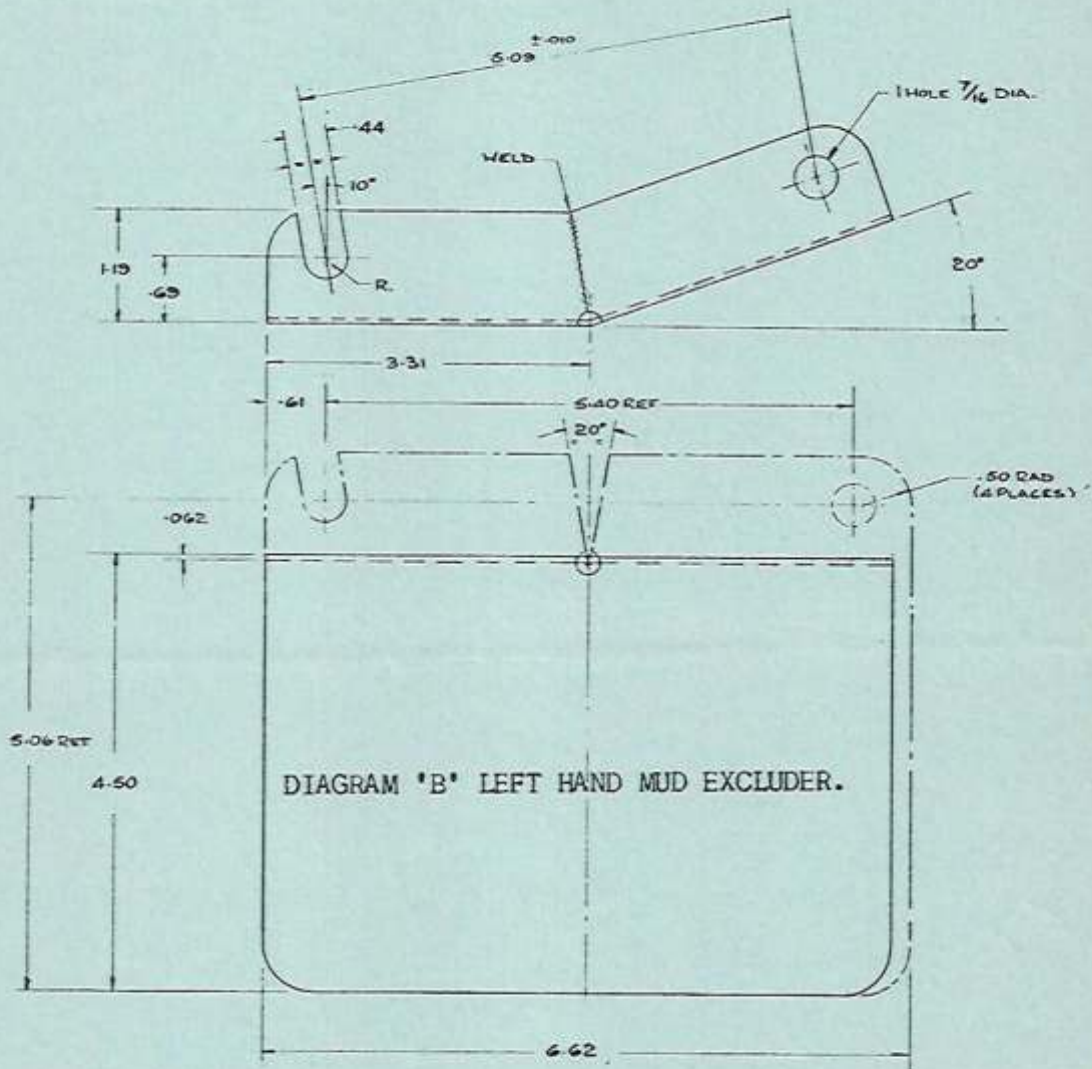


DIAGRAM 'B' LEFT HAND MUD EXCLUDER.

INSIDE BEND RAD. .09